

Generation 2

NZ Timber Cladding Systems



VERSION V1 01/03/2018

NATURAL. DURABLE. CLASSIC.

PROUDLY MADE IN NZ BY



Naturally Better ■ ■ ■

Table of Contents

DISCLAIMER.....	3
1.0 SCOPE.....	3
1.1 Intended Use.....	3
1.2 Product Information	3
2.0 USE OF KLC Generation 2 BOARD & BATTEN WEATHERBOARD PROFILES	4
3.0 LIFE SERVICEABILITY	6
4.0 CARE AND SITE STORAGE.....	7
4.1 On-Site Storage.....	7
4.2 Handling	7
5.0 GUIDELINES.....	8
5.1 Pre-Installation Checks.....	8
5.2 Installation.....	8
5.3 Framing	9
5.4 Nail Selection	9
6.0 INSTALLATION DETAILS FOR BOARD & BATTEN WEATHERBOARDS.....	10
6.1 Board and Batten	10
6.2 Fixing Detail for Direct Fix Application	11
6.3 Bottom of Cladding	12
6.4 Wall Penetration	12
6.5 Window and Door Heads	13
6.6 Cutting and End Sealing	13
6.7 Soakers and Flashings	13
6.8 Box Corners for external Corners	13
6.9 Internal Corners.....	15
6.10 General Inter-Storey Junctions	15
7.0 FASCIA INSTALLATION	16
8.0 PAINTING REQUIREMENTS.....	17
9.0 MAINTENANCE	18
10.0 HEALTH AND SAFETY.....	19
11.0 DETAILED DRAWINGS SECTION	20

DISCLAIMER

The recommendations contained in this document are based on good building practice, but are not an exhaustive statement of all relevant information. The successful performance of the system relies on many factors outside the control of KLC Limited, such as the quality of workmanship and design. KLC Limited will not be responsible for the installation of the products outside of the control of KLC Limited. It is the responsibility of the building designer of the intended project to ensure that the details and recommendations provided are suitable and that the design is executed appropriately.

1 Scope

1.1 Intended Use

The information contained within this guide are based on good building practice and are not a complete statement of all relevant building practices.

Including:

- NZS 3602:2003 Timber Wood Based Products
- NZS 3617:1979 Specification for profiles of weatherboards, fascia boards and flooring
- AS/5068 Finger Joints in Structural Products
- AS/5069 Finger Joints in Non-Structural Products
- NZS 1328.1:1998 Glued Laminated Structural Timber

Meets and Exceeds:

- NZS 3640:2003 Preservation of timber and wood based products

1.2 Product Information

KLC Generation 2 H3.2 products are manufactured from short lengths of clear high grade radiata pine that are finger-jointed together using a structural glue to produce an untreated length of 6.3metres (substrate). The substrate is then treated to H3.2, using the revolutionary water based micronised copper timber treatment technology called "MicroPro". The blanks are then kiln dried (KD) to a pre-determined moisture content. The KD H3.2 substrate is then profiled to various Weatherboards, Fascia, Finishing Boards (D4S), box corners and other profiles. To complement these appearance grade products, a dual coat alkyd priming system is applied. Generation 2 H3.2 MicroPro® (MCA) treated products provide protection from termites, borers, and fungal decay, and are backed by Koppers Performance Chemicals 50 year treatment guarantee. (www.kopperspc.co.nz).

KLC will not "Warranty" any Generation 2 H3.2 product that has not been stored correctly and installed by a professional Licenced Building Practitioner and as per the NZ Building Code and painted in accordance with AS/NZS 2311 2009.

2 Use of KLC Generation 2 Board & Batten Weatherboard Profiles


KLC Generation II H3.2 vertical profiles have been designed for use in residential and small commercial building applications. The weatherboards are a minimum width of 18mm and are available in a range of face profiles.

The KLC Generation II H3.2 vertical profiles are an Acceptable Solution in E2/AS1 for direct fix only. However horizontal cavity battens can be used for cavity fix as an Alternative Solution.

Options are:

a. H3.2 Castellated cavity battens

H3.2 Castellated cavity battens have gaps machined into them at approximately 80mm centres. They have a downward beveled slope on the top at an 18 degree angle to assist draining water. They are to be fixed onto every nog/dwang using 40x2.5 galvanised flat head nails or 50mm galvanized brad nails.

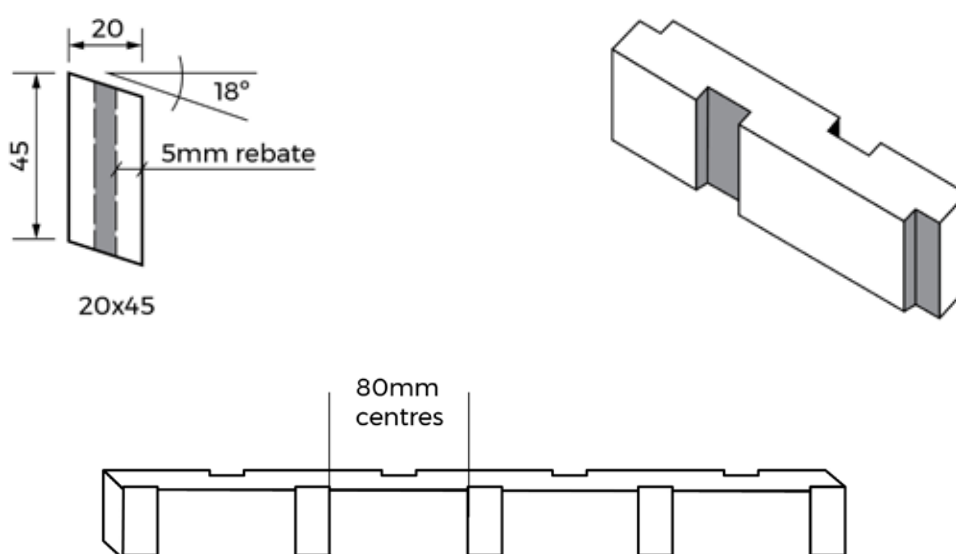

b. Cavibat

Cavibat is an extruded polypropylene fluted cavity batten. Cavibat's are installed with 40.2.8mm galvanized flat head nails or brad gun nailed with galvanised bradsat 400 centres. Please refer to Cavibat's technical guide for full installation details.



2 Use of KLC Generation 2 Board & Batten Weatherboard Profiles


KLC Generation 2 H3.2 vertical profiles can be used for buildings that fall within the scope of NZS3604 Timber Framed Buildings and Acceptable Solutions E2/AS1.

Although timber weatherboards can be used on buildings that have a maximum weather tightness Risk Matrix Score of 20, you will need to use Acceptable Solutions E2/AS1 Table 3.0 to ascertain the use of direct fix or on a cavity fixing system.

All types of weatherboard profiles may be used in low risk buildings. Only bevel back, rusticated and vertical shiplap weatherboards should be used in high risk buildings. For information on requirements for rained ventilated cavities refer to the Acceptable Solution E2/AS1, paragraph 9.1.8.

Weatherboard cladding systems are an acceptable solution under the terms of the New Zealand Building Code E2/AS1. NZBC E2/AS1 section 1.5 specifies that the design, installation and alteration of cladding is classed as restricted building work. The KLC Generation 2 cladding products must be installed by a Licensed Building Practitioner (LBP)

BOARD AND BATTEN PROFILES

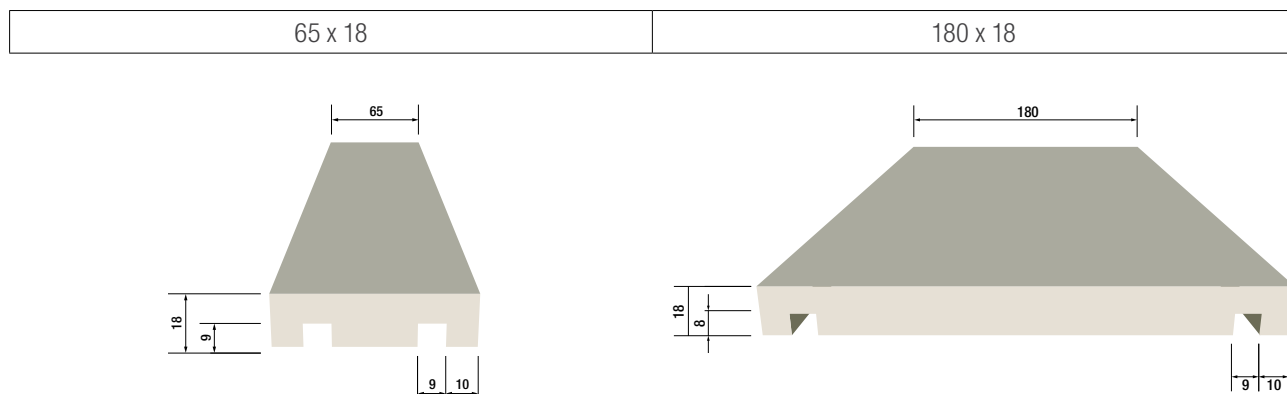

3 Life Serviceability

KLC Generation 2 weatherboards have a durability warranty based on the Treatment Manufacturer's 50 year limited guarantee.

Under the New Zealand Standards NZS 3602:2003 Weatherboards and cladding products must have a minimum durability of 15 years.


The life service is subject to correct installation, paint coating of the product, maintenance and care.

When KLC Generation 2 weatherboards are installed according to the instructions contained in this manual and by a Licensed Building Practitioner (LBP) or suitably qualified person, the service life can be expected to be considerably longer.

Full details covering all the aspects of pre-installation care, installation, painting and maintenance are contained within this manual.

4 Care and Site Storage

To avoid exposure to the elements in all seasons.

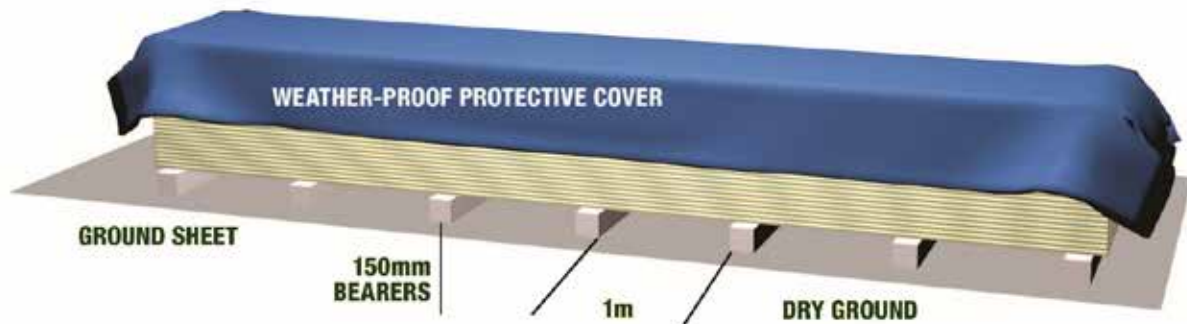

4.1 On-Site Storage

Correct on-site storage of KLC Generation 2 products prior to installation is critical.

- KLC Generation 2 products are made from kiln dried timber. Timber will absorb moisture in a damp environment, and release it in a dry environment.
- Store in a dry, well ventilated area.
- Store on a flat surface 150mm above the ground, supported every metre along the length of the product.
- Protect from the elements including direct sunlight and rain.
- If stored outside, there must be a moisture barrier (ground sheet) under the stack.
- If KLC Generation 2 H3.2 products do absorb moisture prior to installation, dimensional swelling may occur, this will disappear when the timber returns to its original moisture content.

4.2 Handling

- Care should be taken when unloading KLC Generation 2 product. The profiles should be unloaded by hand or if unloaded by mechanical means, ensure that there is a minimum of 2 well-spaced load points to avoid excessive bending or sag during unloading.
- Always carry profiles products on their edge and avoid leaning against any vertical surface to avoid any bending.

5 Guidelines for Installation

The products should be installed by a competent qualified person in accordance with the provisions of the Building Code E2/AS1 (sec 9.4) and NZS 3604 (2011). For further information visit BRANZ Good Practice Guide, Timber Cladding.

5.1 Pre Installation Checks

There are many simple checks that should be carried out prior to installation which can avoid issues during installation.

- Where any KLC Generation 2 profile has been exposed to moisture prior to installation, the moisture content should be checked. If the moisture content is above 15% then the product should not be installed until it returns to 15% or less.
- When excessive moisture or swelling is found the profile should be put aside and allowed to dry to its original profiled dimensions. This is best done by placing the product in fillet and stored as outlined above. Filleting allows air movement through the boards for drying.
- Check for any defects or damage caused during delivery or storage.
- Remove any dirt, dust or stones which may be on the product.
- If there are any areas where a primer coat has been removed or damaged, the affected area should be sanded smooth and a primer coat applied.
- This product is primed with a factory applied alkyd architectural coating, a similar oil-based undercoat or primer must be used for touch-up work
- If building in “sea spray or geothermal zones”, it is the building designers responsibility to ensure all specified fastenings, fittings, and flashings comply with NZS 3604, Section 4 – Durability.

5.2 Installation

- Installation must be by a Licensed Building Practitioner (LBP), or supervised by an LBP. Please refer to BRANZ Bulletin Number 468, Fixing of Timber Weatherboards.
- Do not install Generation 2 H3.2 weatherboards if their moisture content is over 15%.
- If building in “seaspray or geothermal zones”, it is the building designers responsibility to ensure all specified fastenings, fittings, and flashings comply with NZS 3604, Section 4 – Durability.
- Avoid joining KLC Generation 2 H3.2 vertical weatherboards whenever possible, ensure a good pre-set out to use full length boards.
- Re-prime all cut ends, mitres, notching's, borings with 2 coats of brush-applied alkyd primer.
- Stud centres are at 600mm max, Nogs/dwangs centres at 480mm max.
- Use full length boards only, nail at the centre of the board
- Single fix through the gap between boards at every fixing point. Nails to be driven in with a slight upward slope.
- The weatherboards must overhang the bottom plate by a minimum of 50 mm.

5 Guidelines for Installation

5.3 Framing

The timber framing must comply with NZS3604 – Timber Famed Buildings with maximum of 600mm centres.

- The moisture content of the framing must not exceed 20% at the time of fixing the weatherboard. Excessive moisture content in the timber framing may cause movement in the framing structure thus altering the weatherboard positioning.
- Additional framing may be required at soffit, corners, windows and door opening

5.4 Nail Selection

KLC Generation 2 H3.2 weatherboards are treated using the revolutionary water based micronised copper timber treatment technology called “MicroPro (MCA)”.

- In most applications both stainless steel and hot dip galvanised steel fixings and fasteners are safe to use with MicroPro® (MCA) treated exterior products. Compliant to AS/NZS 4680 and to NZBC E2/AS1 Table 24.
- Note In sea-spray and Geothermal zones nails must be Stainless Steel.
- Hand nailing is recommended as the use of nail guns can cause fibre damage to the face and back of the board.

Based on MicroPro® (MCA) ISANTA fastener corrosion test results, MicroPro® (MCA) treatment is considered similar to CCA treatment with regard to the effects on fastener material. Therefore, in most applications both stainless steel and hot dip galvanised steel fixings and fasteners are safe to use with MicroPro® (MCA) treated exterior products. Compliant to AS/NZS 4680 and to NZBC E2/AS1 Table 24.

Fixings are to comply with E2/AS1 Table 24

NAILING SCHEDULE

Weatherboard	Framing Set-out	Nails (direct fixing)	Nails (on cavity)	Nailing requirements	Wind Zone	Wind Barrier*
Board and Batten Weatherboards	Studs @ 600mm centres max. Nog centres at 480 mm	75mm x 3.15mm Jolt Head (JH) Hot Dipped Galvanised Nails or Stainless Steel Nails 35mm penetration into the board	90mm x 3.15mm Jolt Head (JH) Hot Dipped Galvanised Nails or Stainless Steel Nails 35mm penetration into the board	Single nail on every nog centred from side edge of the board	Low, Medium, High & Very High	Lightweight Building Paper Heavyweight Building Paper
External & Internal Corners Box Corners	All weatherboards	50x2.5mm Jolt Head (JH) Hot Dipped Galvanised Nails 250mm centres	50x2.5mm Jolt Head (JH) Stainless Steel Nails 250mm centres	300mm centres maximum		

Note: Hot dip galvanising must meet the requirements of AS/NZS4680:2006. In Expose Zone D (refer to NZS 3604 paragraph 4.2.3) all fixings must be type 316 stainless steel

6 Installation Details for Board & Batten Weatherboards

6.1 Board and Batten

Note: KLC Generation 2 H3.2 Board and Batten weatherboards are for Direct Fix application only. KLC have provided drawings and installation methods for only direct fix installation.

- Hand nailing is recommended as nail guns can cause damage to the surface of the board. If a nail gun is used, a non-marking attachment should be used to avoid damage to the surface.
- Use 75 x 3.15 Hot Dipped Galvanised or Stainless Steel nails for fixing KLC Generation 2 H3.2 Board and batten weatherboards. Nails must have a minimum penetration of 35mm in to the wall framing. Refer to BRANZ Bulletin 468 and E2/AS1 for complete list of fixing options.
- Nail holes should be pre-drilled especially in areas around joins and the end of boards. This is to avoid splitting the product. Pre-drill all boards 50mm from the end to avoid end splitting.
- Single nail all weatherboard profiles, regardless of size. Nailing boards together will likely result in split boards.
- Location of nails is centre of each board, approximately 90mm from the side edge of the board. Aligning the weather grooves on the front face with the over batten is crucial.
- Use full length boards only.
- Stud centres are at 600mm max, Nogs/dwangs centres at 480mm max.
- Nail at the centre of the board
- Single fix through the gap between boards at every fixing point. Nails to be driven in with a slight upward slope.
- The weatherboards must overhang the bottom plate by a minimum of 50 mm.
- Nails should be applied at an upward angle of 10degrees to avoid water entering through the fixing point.
- All nails should be punched to a depth of no less than 2mm.
- As soon as nails are punched below the surface of the weatherboard they must be filled with an exterior grade filler immediately to prevent moisture uptake in the weatherboards.
- Timber weatherboards are designed to accommodate thermal, seismic and moisture related movement in the boards laps. Each weatherboard is single nailed so that the weatherboards can expand, contract and move independently of each other. KLC does not recommend the use of any sealant/glue which inhibits the natural and ongoing movement of the weatherboard.

6.2 Fixing Detail for Direct Fix Application

KLC Generation 2 H3.2 Vertical Weatherboards can be directly fixed to the framing but the use of this is limited by section 3.3 of E2/AS1.



All types of weatherboards can be used where the risk score is between 0 and 6.

Where weatherboards are directly fixed to the framing a wall underlay complying with Table 23 of E2/AS1 sections 9.1.5-9.1.7 shall be installed prior to fixing.

Refer to detailed drawings section

6 Installation Details for Board & Batten Weatherboards

D3.6/a Board & Batten Direct Fixing Detail

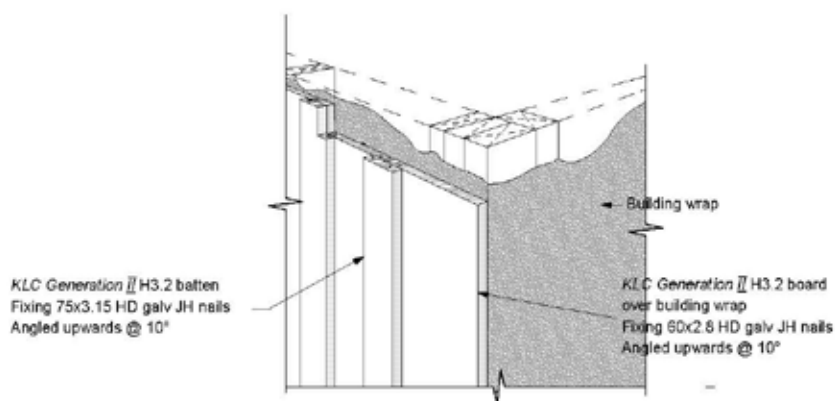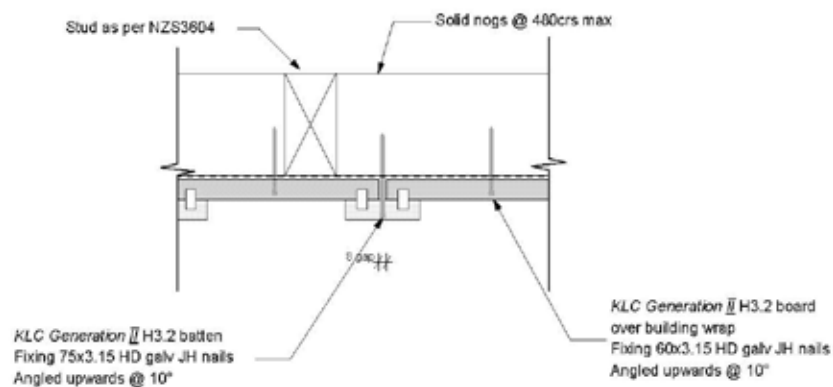

6 Installation Details for Board & Batten Weatherboards

6.3 Bottom of Cladding

There are differing requirements for the clearance between cladding, ground and pavers.

Wall cladding and concrete slabs:

- Weatherboards must overlap the floor structure by no less than 50mm.
- Ensure the bottom of the weatherboard is no closer than 150mm from a paved/concrete ground surface or 225mm from an uncovered ground surface. Ensure the end is completely sealed with a quality primer
- Overlap the concrete slab by a minimum of 50mm.
- Direct fix cladding must have a minimum horizontal off-set of 6mm to prevent moisture capillary action.
- Wall Cladding on suspended timber floors:
 - With drained cavities there will be no direct connection between the sub floor spaces and the drained cavities.
 - Direct fix cladding must have a minimum horizontal offset of 6mm to prevent moisture capillary action.
 - With drained cavity systems care must be taken to ensure air from the sub-floor space cannot enter the cavity.

Refer to detailed drawings section

6.4 Wall Penetration

Prior to the installation of doors and windows the following must be completed:

- Wall underlay shall be cut and dressed on all sides.
- Flexible flashing tape shall be applied to the head and sill framing.

Windows, doors and other penetration openings shall have a flexible air seal to minimise the risk of air flow carrying moisture into the building wall.

The air seal shall:

- Be between the reveal or the frame and the wrapped opening.
- Installed over closed cell polyurethane foam, backing rod or similar product.
- Be made of:
 - a. Self-expanding polyurethane foam
 - b. A sealant complying with Type F, class 20LM of ISO 11600 or a low modulus Type II Class A Federal Specification TT-S-00230C.

Refer to detailed drawings section

6 Installation Details for Board & Batten Weatherboards

6.5 Window and Door Heads

When installed the flange forming the window, door facing must overlap the cladding material or the back flashing by a minimum of:

- 10mm on jambs
- 8mm on sills

Direct Fix Weatherboards:


When installing direct fix weatherboards, window and doors shall have a 5mm stand-off from the flange to the weatherboard to allow for air equalisation. The gap is to be sealed or trimmed down the jamb but left open along the sill.

Head flashings must have a 50mm bead of sealant installed between the weatherboard and each end of the head flashing.

Refer to detailed drawings section

6.6 Cutting and End Sealing

- All cut ends, drill holes, rebates and notches must be resealed immediately with a suitably approved product. eg an Alkyd (oil-based) Primer
- End sealing can also be achieved by the application of 2 coats of brush-applied, quality Alkyd (oil based) primer which are allowed to dry between coats.
- Avoid joining KLC Generation 2 H3.2 vertical weatherboards whenever possible, but if unavoidable use a 45 degree angle joint directly over nogs. The top board overlapping the bottom board
- Use one single nail through the overlapping board to join.

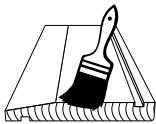

Two coats of an Alkyd primer (oil-based) or end sealer.

6.7 Soakers and Flashings


Soakers and flashings can be Galvanised Steel, Aluminium, Stainless Steel (304) or Copper. All these materials are compatible with the KLC Generation 2 H3.2 profiles. These are safe to use with MicroPro treated products.

Soakers and flashings must be fixed in accordance with the NZS3604:2011 and Acceptable Solution E2/AS1.

Soakers must have a minimum of 15mm overlap from the corner or join. Flat soakers to be used on all butt joins.


NZS 3604:2011 section 4 and Table 6.12 outline durability for flashings. Section 9 of E2/AS1 outlines flashing design and fabrication details.

6 Installation Details for Board & Batten Weatherboards

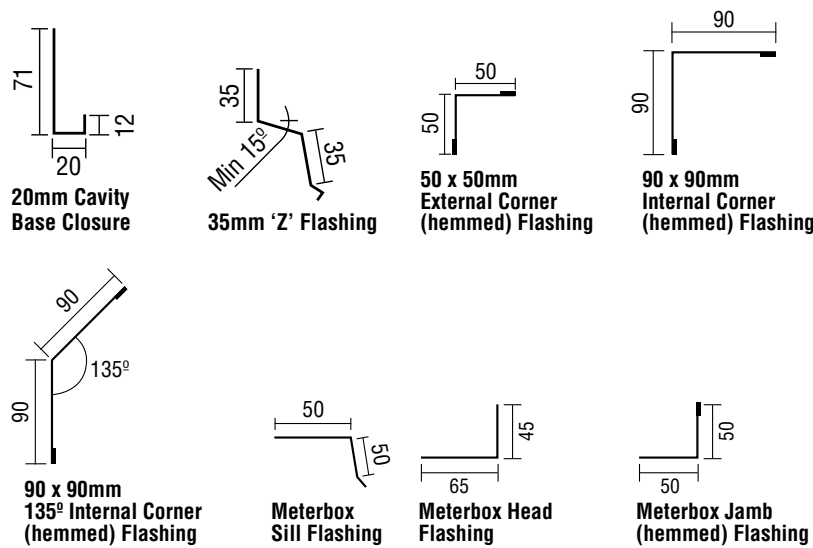

General Sealing of Head Flashing

Note: May also use wall underlay lapped over flashing upstand in lieu of flexible flashing tape.

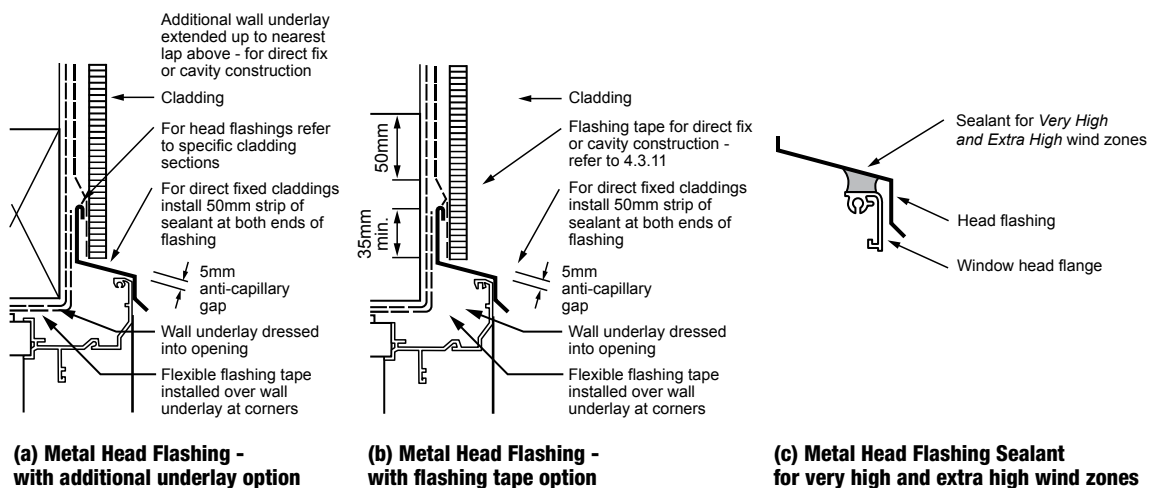

6.8 Box Corners for external corners

The KLC Generation 2 H3.2 Box Corner profile range includes an internal and external box corner piece 98x18 and an external and internal piece 85x18. Both being a two piece system.

- Position the Box Corners and nail over the KLC Generation 2 H3.2 vertical weatherboard using a 75x3.15mm galvanised or stainless steel jolt head nails at approximately 450mm centres, taking care to not nail through two layers of weatherboard.
- Ensure all cut end are sealed immediately with a suitably approved product. eg an Alkyd Primer
- The boxed corner must provide a minimum cover of 50mm from the cut end of the weatherboards. Boxed corners are made weather proof by the following method:

Refer to detailed drawings section

6 Installation Details for Board & Batten Weatherboards

6.9 Internal Corners

Internal corners must be made water tight by the use of corrosion-resistant flashings which shall be fitted behind the weatherboards on all internal corners.

Refer to detailed drawings section

6.10 General Inter-storey Junctions


Inter-storey junctions in cladding over drained cavity systems shall be formed for walls over 2 storeys or 7 metres in height.

Cavity battens used, can run the full height of the wall, however walls over 7 metres or 2 storeys must have an Inter-Storey Junction. This is formed to allow for the management of moisture handled by the cavity to be directed to the outside of the building.


The Junction must have:

- A Minimum 15mm drip edge
- A minimum 5mm capillary gap Flashing used must have:
- A Minimum 15 degree slope
- A minimum 35mm up stand
- A minimum 35mm cover over the weatherboard


Internal Corners for Horizontal and Vertical Weatherboards

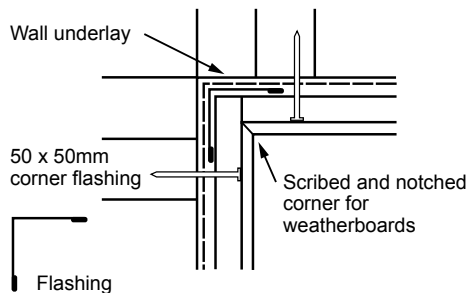


(a) Direct Fix - Internal Butt Corner

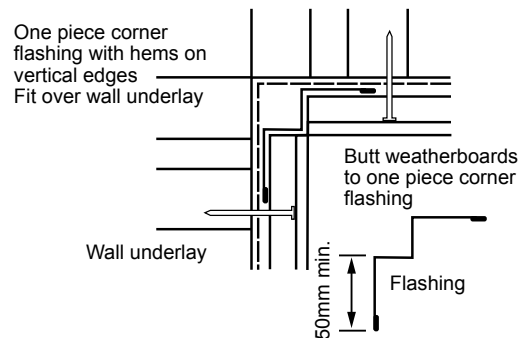

(b) Direct Fix - Internal Corner Flashing

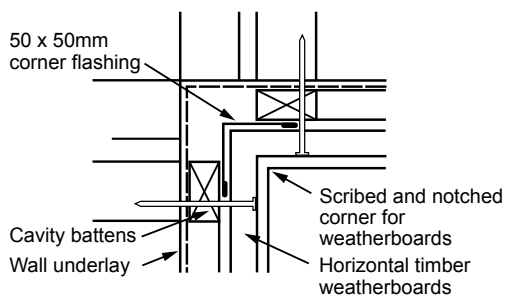


(c) Cavity - Internal Butt Corner

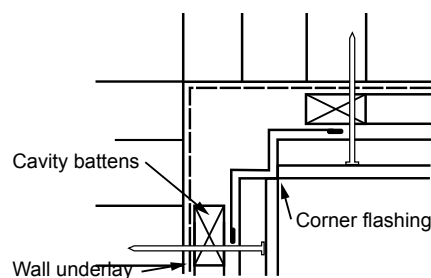

(d) Cavity - Internal Corner Fillet

7 Fascia Installation

As an alternative to nail fixing, fascia can be screwed onto rafter ends as wide as is practical with wide head (10mm) Stainless steel screws, slightly countersunk. Screws should be a min. 75mm long.

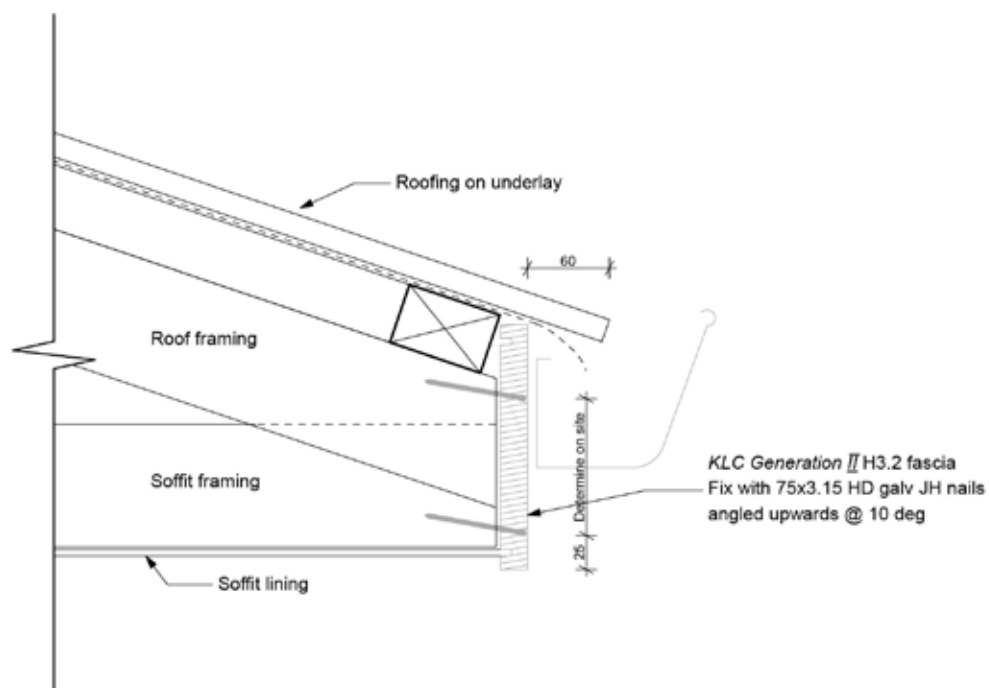

KLC Generation 2 H3.2 products have a premium factory applied alkyd primer and undercoat applied in two separate coats.

- All painting must be carried out in a good tradesman-like manner and in accordance with AS/NZS 2311 2009. Please also refer to “BRANZ Good Practice Guide to Exterior Coating”.
- Do not paint Generation 2 H3.2 weatherboards if the moisture content is over 15%.
- Remove any dirt and surface contamination by sanding and dusting down. Prime immediately any exposed bare timber with a premium exterior alkyd primer.
- Darker colours will absorb heat from the sun and may cause excessive movement, distortion, cracking and possible resin bleed. Light colours reflect the sun's heat.
- The KLC warranty will be void if dark colours with a Light Reflectance Value (LRV) less than 45 are used.
- KLC Limited recommend an application of two coats of quality exterior house paint at a rate no greater than 12m² per litre per coat.

Top Coat Light Reflectance Values as recommended by KLC



The significance of Light Reflectance Values is now being recognized by the building industry.

When paint is exposed to sunlight it absorbs and reflects radiant heat (as well as UV light). It's not only radiant heat warming up the paint film that is the problem. Damage is caused by temperature changes (i.e. from hot sun to cloudy sky) causing the paint film to go through a process of heating up then cooling down again resulting in changes in dimensional stability of the timber substrate. Increases in the core temperature of the timber substrate can also cause resins to mobilise and leach through the paint film. This is known as resin bleed.

The other factor to consider is UV light, the other part of the sun's spectrum. When UV light hits the paint film it causes the release of free radicals that can damage the surface.

Light paint colours with a high light reflectance (and therefore a high LRV over 45) allow less free radicals to be released, which means the paint film and substrate will last longer. Correspondingly dark colours with a lower light reflectance allow more free radicals to be absorbed therefore causing more damage to the surface and resulting in reduced life for the paint film.

KLC recommend choosing a colour with an LRV of 45 or higher for use on all KLC timber products coated with PPG 839 alkyd primer.

9 Maintenance

It is the responsibility of the home owner to ensure that annual maintenance is carried out. Maintenance should be carried out every 12 months. In some cases, this may be required more regularly eg. sea spray

Maintenance Checklist

1. Wash all exterior surfaces using a low-pressure wash system to remove dust, dirt and other contaminants.
 - Do not use a high pressure washing system eg water blaster
 - If the washing does not remove stubborn areas of mold or dirt use a soft brush or broom and an appropriate cleaning agent to remove these deposits. Check with the paint manufacturer and read the directions on the product to apply the cleaning agent.
2. Once the building is clean and the surfaces have been inspected for damage, wear and tear and paint coating degrade then repairs and must be undertaken immediately.
If the paint surface has been damaged then:
 - Remove all damaged paint, sand back if required
 - Apply a quality primer on any bare timber
 - Once the primer has dried apply 2 top coats of a quality top coat paint.
3. It is a general rule that timber weatherboard homes should be repainted every 10 years if the initial coating product used was of good quality, delivering a good quality coating finish. In some cases repainting may be required earlier depending on condition and exposure to harsher elements

10 Health and Safety

Health and safety precautions should be adhered to when working with all wood products.

Machine tools should be fitted with dust extractors and work areas should be kept clean.

If dust levels exceed Work Safe New Zealand Standards, the wearing of a dust mask (AS/NZS 1715 & AS/NZS 1716) and protective eyewear (AS/NZS1336 & AS/NZS 1337) is recommended.


Storage and work areas should be adequately ventilated.

DRAWINGS DIRECTORY


Direct Fix

D1.1	Foundation, Timber Floor	21
D1.2	Foundation, Concrete Floor	21
D1.3	Door Sill, Timber Floor	22
D1.4	Door Sill, Concrete Floor	22
D1.5	Window Head	23
D1.6	Door Jamb	24
D1.7	Window Sill	24
D1.8	Window Jamb	24
D1.9	Soffit Junction	25
D1.10	External Box Corner	25
D1.11	Internal Box Corner	25
D1.13	Meter Box Head	26
D1.14	Meter Box Jamb	27
D1.15	Meter Box Sill	27
D1.16	Pipe Penetration	28
D1.17	Apron	28
D1.18	Parapete	29
D3.6	Direct Fixing	29

D1.1 Foundation, Direct Fix, Timber Floor

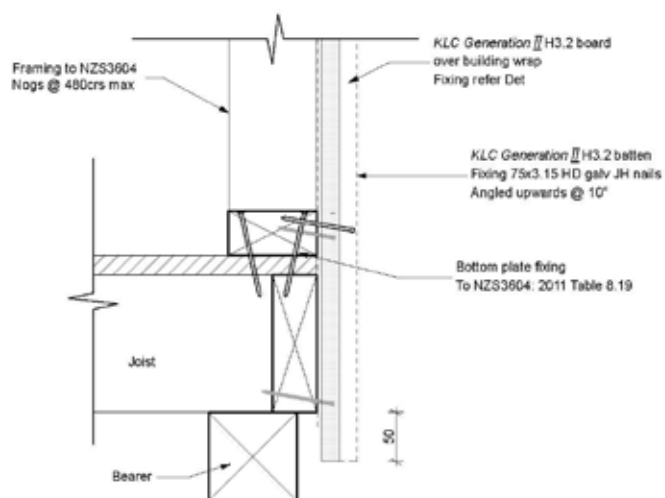


D1.2 Foundation, Direct Fix, Concrete Floor

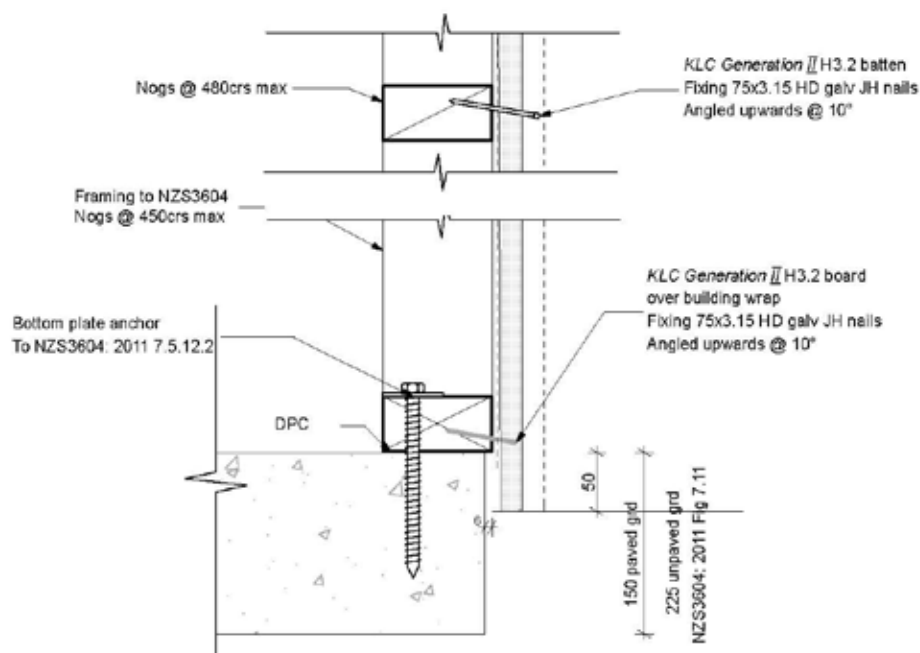


11 Detailed Drawings


D1.3 Sill, Direct Fix, Timber Floor

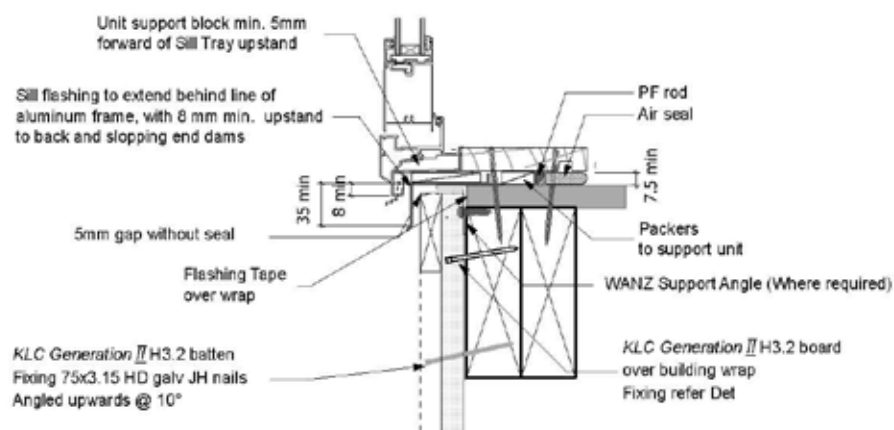


D1.4 Sill, Direct Fix, Concrete Floor

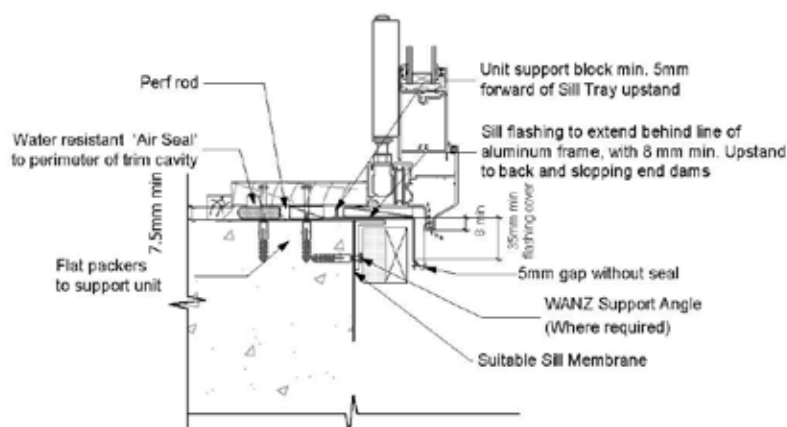

D1.5 Window Head, Direct Fix

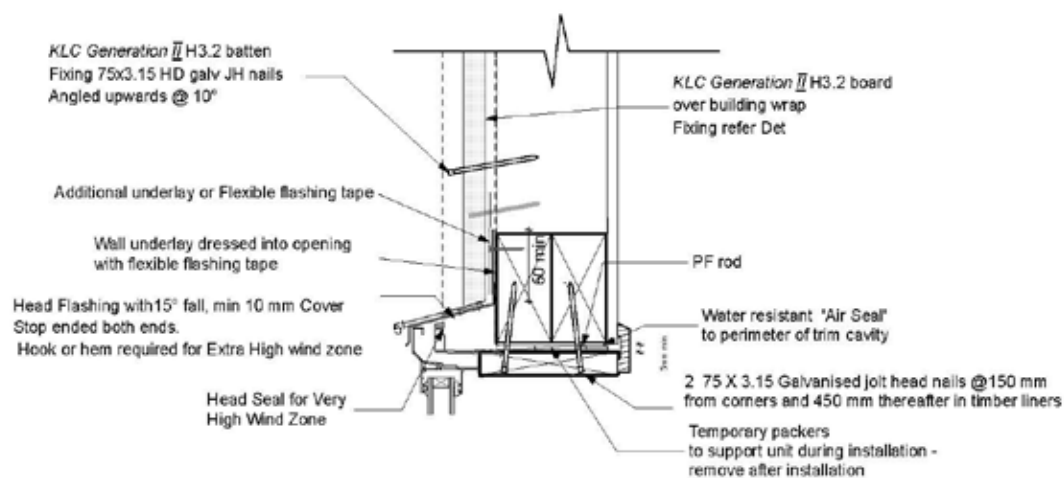


D1.6 Door Jamb, Direct Fix

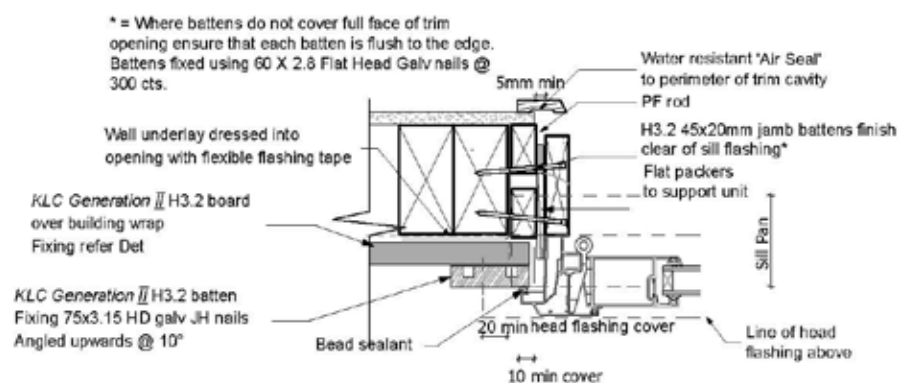


11 Detailed Drawings


D1.7 Window Sill, Direct Fix

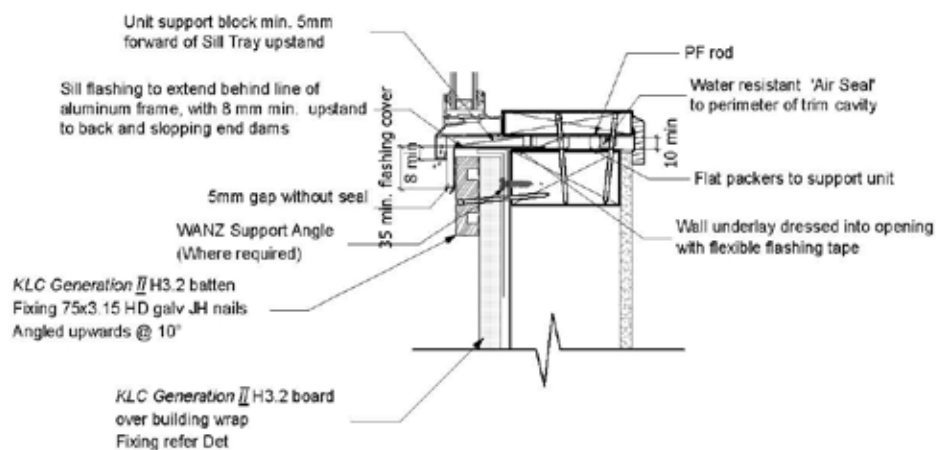


D1.8 Window Jamb, Direct Fix

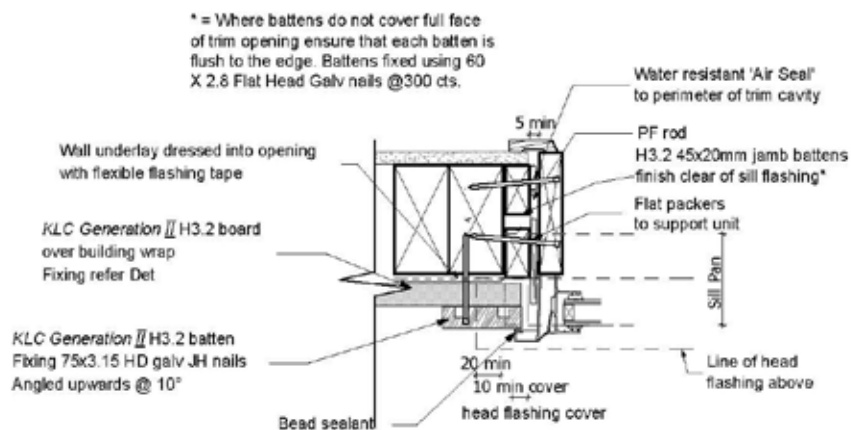

D1.9 Soffit Junction, Direct Fix

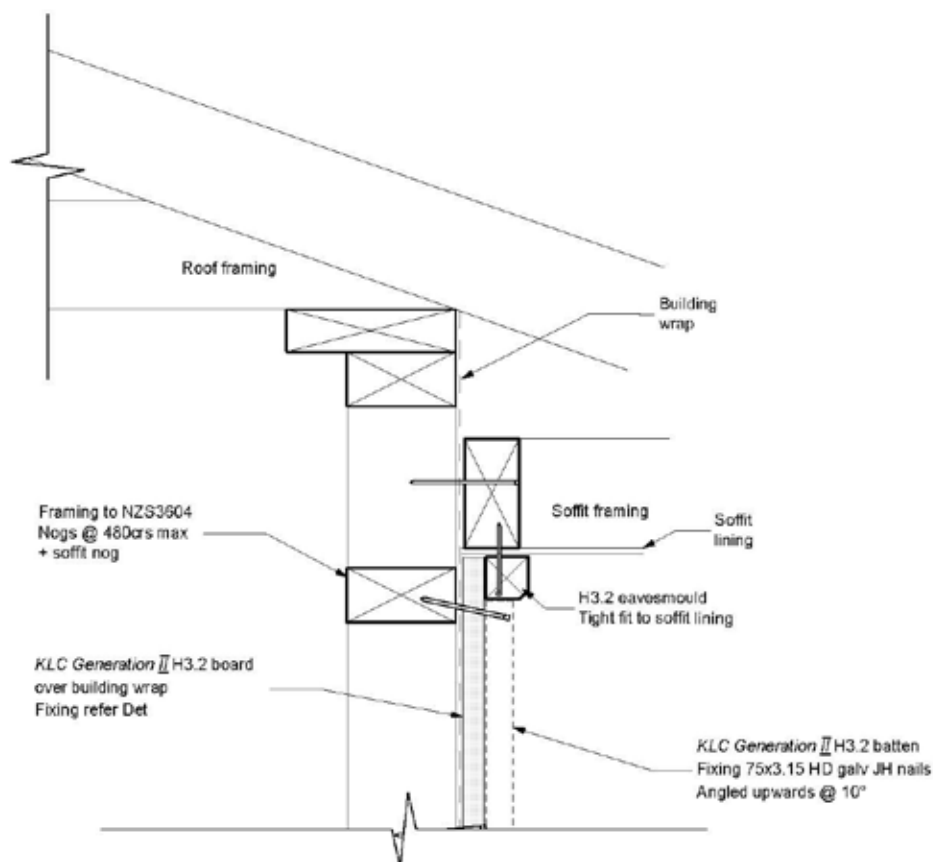


D1.10 External Box Corner, Direct Fix

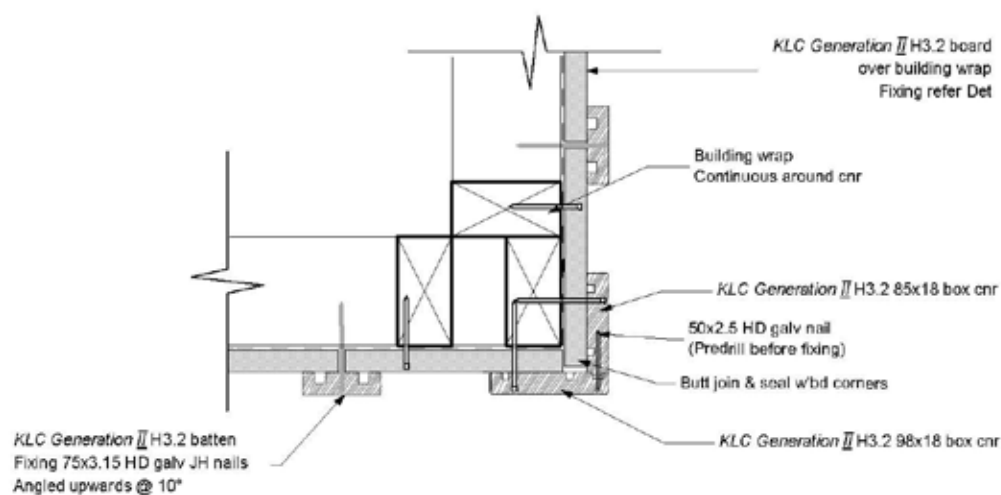


11 Detailed Drawings


D1.11 Internal Box Corner, Direct Fix

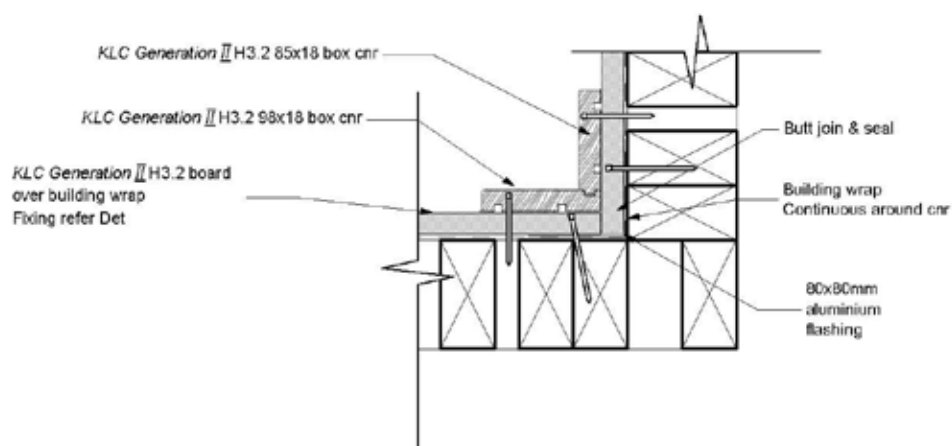


D1.13 Meter Box Head, Direct Fix

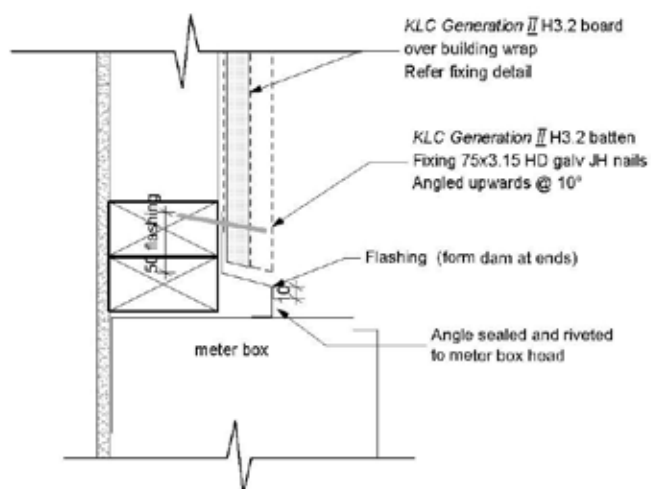


D1.14 Meter Box Jamb, Direct Fix

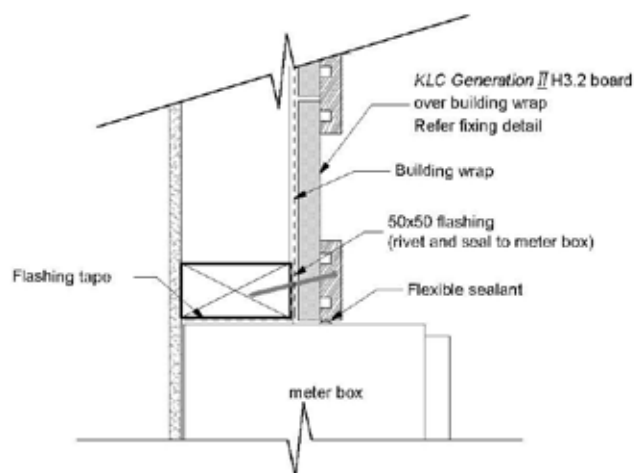


D1.15 Meter Box Sill, Direct Fix

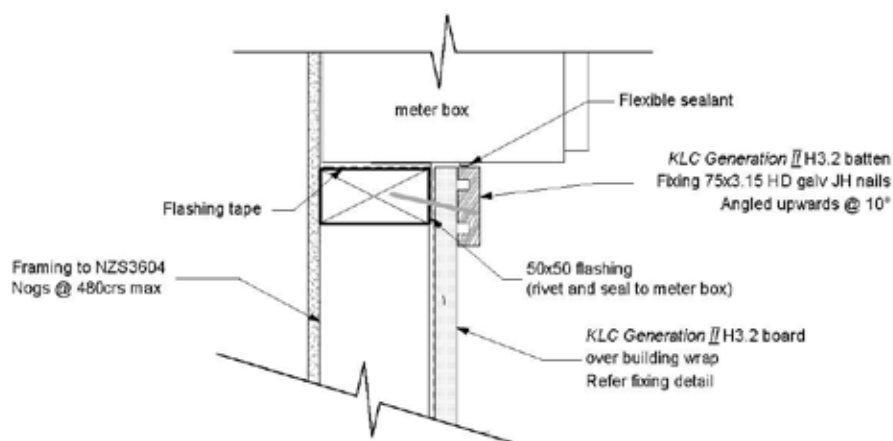

D1.16 Pipe Penetration, Direct Fix

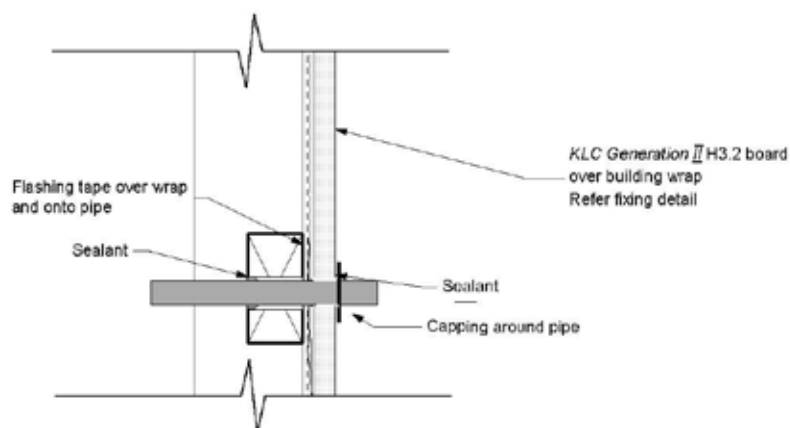


D1.17 Apron, Direct Fix

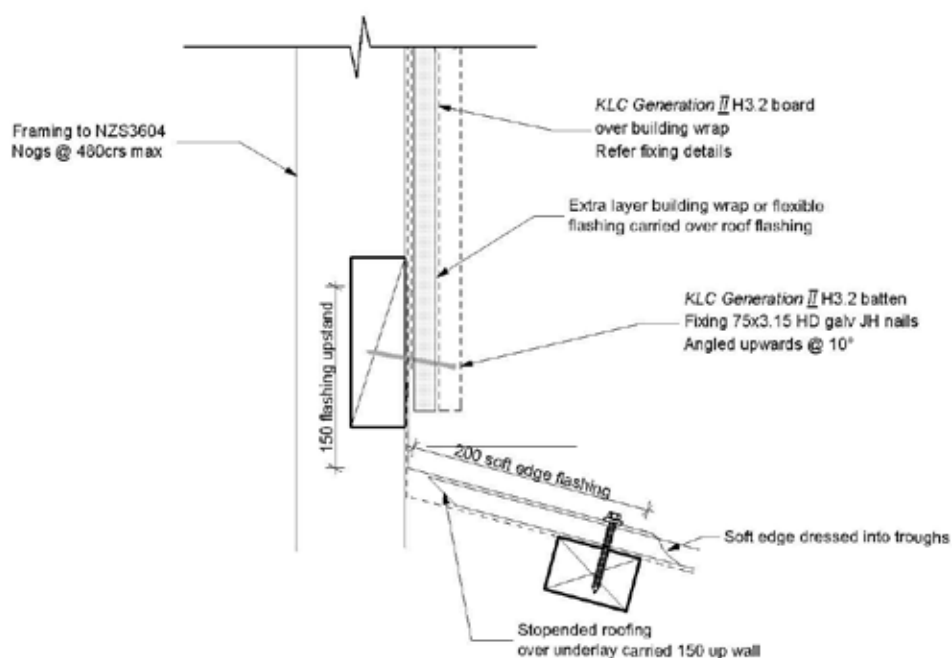

11 Detailed Drawings

D1.18 Parapete, Direct Fix

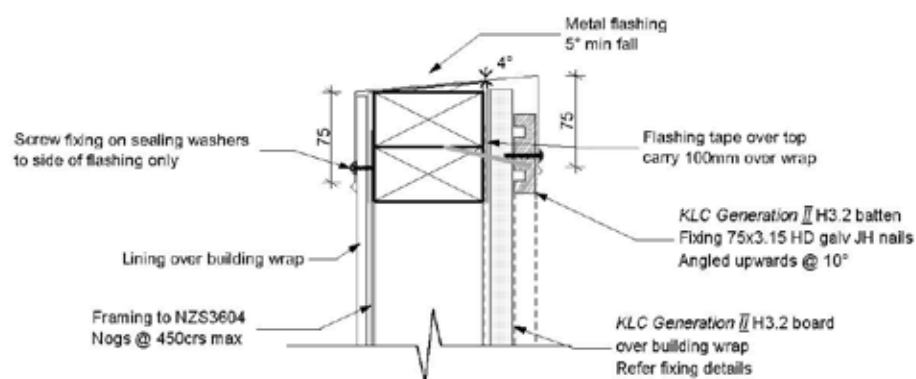

D3.6/a Fixing Detail Batten / Fixing Detail Board

